# Hazardous-Area Approved DP1007











### **Product Features**


Continuous Monitoring in Hazardous Locations


Measures shaft vibration and displacement on machinery with fluid film bearings

- ▶ 11 mm probe tip diameter with 1/2-20, 3/8-24, M14x1.5 or M10x1 threaded body
- ▶ Probe tip and body sealed to prevent leaking
- Upgraded to include SecureLock connector

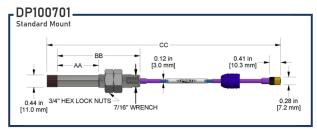

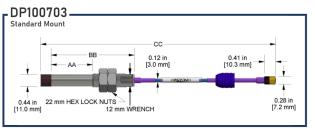

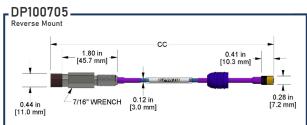

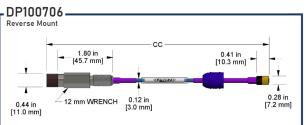

Lengths AA, BB, and CC are configurable

Specifications	
Temperature Range	-49 to 350 °F (-45 to 177 °C)
Sensitivity	-100 mV/mil (-3.94 V/mm) (1 mil = 0.001 in.)
Material	FEP Cable Jacket with 316L Stainless Steel Probe Body
Case Thread	1/2-20 or M14x1.5 (Standard Mount) or 3/8-24 or M10x1 (Reverse Mount)
Wrench Flats	7/16 in. or 12 mm
Rating	IP68
Connector	SecureLock
Connector Pull Strength	Un to 30 lbs

#### **Built to Order**

## Regulatory Approvals

#### US & Canada:

Class I Division 1 Groups A. B. C. D Class II Division 1 Groups E, F, G Class III Class I Zone O AEx ia IIC Class I Division 2 Groups A, B, C, D Class II Division 2 Groups E, F, G Ex ia IIC Ga

### ATEX:

SIRA 16ATEX2084X Ex ia IIC

## Temperature Codes:

T4 = -45°C to 100°C T5 = -35°C to 85°C

International (IECEx): IECEx CSA 16.0017X









FOR REFERENCE ONLY, PLEASE REFER TO CONTROL DRAWING